

Error	Description	Cause	Response	Acknowledgement	Remedy	Display
A			Reach truck control unit (RCU)			(1) Error memory only (2) Error memory + display (3) Display only
	A3021	Drive direction switch error	–	–	- Check the wiring - Check the switch	(1)
	A3027	Seat switch error	Seat switch does not release	Automatically if error is rectified	- Check the seat switch - Check the wiring	(2)
	A3035	Brake fluid reservoir: collective fault	Brake fluid level too low or switch faulty	Release the accelerator	Check the brake fluid and switch	(2)
	A3127	Pressure sensor, negative cable break	GND breakdown	No calculation of the pressure measured value (display value: 9999 kg)	- Check the pressure sensor - Check the wiring from RCU XB:44 to 2B31 X1:1 - Replace the pressure sensor - Replace the RCU	(1)
	A3128	Pressure sensor: supply voltage cable break	Supply voltage breakdown	No calculation of the pressure measured value (display value: 9999 kg)	- Check the pressure sensor - Check the wiring from RCU XB:22 to 2B31 X1:3 - Replace the pressure sensor - Replace the RCU	(1)
	A3136	Tilt sensor error	Tilt sensor signal < 0.5 V or > 10.5 V	Tilt centre position locked	- Check the wiring - Check the sensor	(2)
	A3140	Height measurement sensor (belt sensor)	Implausible height measurement signals (incremental transducer tracks and/or signal from the reference switch/free lift switch are incompatible) Additional from software version 0.39: reference value not within the valid range	Functions dependent on the height measurement are locked	Check the height measurement and sensors	(2)
	A3148	Lift height detection: process error	Model calculation for the lift height detects an error	–	Recalibrate the height measurement	
	A3149	Drive direction switch error	A plausibility error for the drive direction switch was detected in the fingertip switch	Reference drive required	- Check the sensor - Check the wiring - Parameters for the pump/mast are incorrectly configured - Perform reference drive for the height measuring system	(1)
	A3150	F button error	A plausibility error for the F button was detected in the fingertip switch	Drive unit is disabled	- Clear the error list - Check the wiring - Replace the drive direction switch	(1)
	A3166	Internal processing error: raise/lower the joystick axis	An error is detected in the joystick	Working hydraulics not active	- Check the F button - Check the wiring - Replace the F button	(1)
	A3167	Internal processing error: move the joystick axis	An error is detected in the joystick	Hydraulic drive is disabled	Replace the joystick	(1)
	A3168	Internal processing error: TILT the joystick rocker	An error is detected in the joystick	Working hydraulics not active	Replace the joystick	(1)
	A3169	Hardware error in the EEPROM or voltage drop during the joystick/fingertip switch calibration process	Hardware error in the EEPROM or voltage drop in the CAN converter during the calibration process	Working hydraulics not active	- Recalibrate the joystick/fingertip switch - Replace the joystick - Fingertip switch: replace the CAN converter	(1)
	A3170	Internal processing error in the joystick/fingertip switch	General error from the joystick/fingertip switch	Working hydraulics not active	- Note other error messages - Replace the joystick/fingertip switch	(1)